


**COPY**

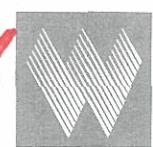

**Walker Corporation**

5 June 2006

Ray Osborne  
Assistant Director - Operations  
Heritage Victoria  
Level 7  
8 Nicholson Street  
Melbourne VIC 3000

Walker Corporation Pty Limited  
ABN 95 001 176 263  
PO Box 248 Prahran  
Victoria 3181 Australia  
Mezzanine Level, Pran Central  
325 Chapel Street Prahran  
Victoria 3181 Australia  
Telephone 03 9521 5877  
Facsimile 03 9521 5047  
[www.walkercorp.com.au](http://www.walkercorp.com.au)

Dear Ray,

**RE: KEW RESIDENTIAL SERVICES REDEVELOPMENT  
HERITAGE PERMIT NO. P10367 – STAGE 1**

We refer to our recent discussions regarding the upcoming remediation works planned to commence at Kew. In this regard, we enclose information as required under **permit condition 3** of the above mentioned permit which relates to the **conservation of trees during works**. Permit condition 3 states that:

An Arboricultural Management Plan, prepared by an arborist is to be submitted for approval by the Executive Director prior to the commencement of the new development on the site. The plan must show or demonstrate:

- A full management plan for the dealing with *Phytophthora cinnamomi* on the site;
- The steps necessary to protect trees during the construction of the development;
- Tree protection zones for all trees to be determined and shown on the plan;
- That the roots will be rigorously protected from damage;
- The precise position of the canopies to be documented to enable evaluation of the impact of works;
- That the construction of or resurfacing of driveways should be rigorously reviewed to ensure that it will not result in a diminution to tree health; and
- The trees and plants that are required to be removed and/or relocated.

As such, please find enclosed the "Kew Cottages - Arboricultural Management Plan" prepared by our consulting arborist Galbraith & Associates dated 10 May 2006. The management plan has been prepared to deal with dot point's two to six above.

Dot point one will be dealt with in a separate report which we propose to submit by Tuesday 6 June 2006. As discussed in our meeting of 2 June 2006, the P<sub>c</sub> management plan exists in draft form and is currently being refined for submission.

We trust the above satisfies the requirements of condition 3, should you have any concerns regarding the attached or the above, please do not hesitate to contact the undersigned on 0408 373 903.

Yours sincerely,  
**WALKER CORPORATION PTY LTD**



**Luke McKie**  
DEVELOPMENT MANAGER



Tree Consultants & Contractors  
40 Glyndon Road, Camberwell 3124  
Tel (03) 9888 5214  
Fax (03) 9888 5063

Kew Cottages  
ARBORICULTURAL MANAGEMENT PLAN



**Tree Consultants & Contractors**  
**40 Glyndon Road, Camberwell 3124**  
**Tel (03) 9888 5214**  
**Fax (03) 9888 5063**

10 May 2006

Mr Andrew Moyle  
MDG Landscape Architects Pty Ltd  
Level 2, 45 Victoria Avenue  
ALBERT PARK 3206

Dear Sir,

**re: ARBORICULTURAL MANAGEMENT PLAN  
Condition 3 of Permit No. P10367 from Heritage Victoria**

**Introduction**

Permit No. P10367 has been issued by Heritage Victoria to build Stage 1 of the proposed development at Kew Cottages, subject to certain conditions. Galbraith and Associates has been retained by Walker Corporation Ltd. to assist in the provision of an arboricultural management plan for the trees to be retained in Stage 1, as per condition 3 of the permit. Galbraith and Associates has also been requested to provide a summary of tree works already undertaken to protect and enhance the safe useful life expectancies of the trees. MDG Landscape Architects have prepared a Tree Protection Plan 0418 LSK11, showing the locations, species identification and status of trees within the Kew site. The management procedures for *Phytophthora cinnamomi* are included within a separate report.

***Recommended Tree Works***

Every tree at Kew Cottages has been numbered on plan and named. Many have had works prescribed to improve their health, safety and appearance. Priority has been given to the following trees for work prescriptions:

- Those listed as heritage or VPO
- Those within Stage 1
- Those which are relatively large or old or of an unusual species which have not already been included in the above.

The prescribed works have already been undertaken on many of the trees. These include numbers 1-6, 8, 8A, 11, 12, 13, 15, 18, 20, 29, 31, 32, 34, 39, 40, 41, 43, 49-52, 54-61, 63, 67, 68, 71, 75, 79, 82, 84-87, 89, 92-99, 296, 297, 388, 409, 435 and 714. The works were undertaken in February and March of this year. Furthermore the northernmost Canary Island Pine of row 600 received urgent bolting and cabling works last year to prevent it splitting apart.

### **Proposed Tree Works**

In the following table of data, the column headed '**Treatment**' refers to the specific works which are advised to be undertaken to the corresponding tree. The recommendations are in abbreviated form and are defined below:

#### **Treatment Definitions**

**I Irrigation** A number of the trees are stressed and in need of irrigation to their root zones.

*Amount of Irrigation* As a rule of thumb, at least four litre should be applied for each centimeter in trunk diameter of the tree, when measured at breast height (DBH). Thus if a tree has a trunk diameter at breast height (DBH) of 60cm, approximately 240 litre should be applied. If the DBH is 30cm, 120 litre must be applied, or if the DBH is 100cm, 400 litre must be applied.

*Manner of Irrigation* The water must be applied to the root zone in a slow manner such that it penetrates the root zone, rather than flowing over the soil surface and out of reach of most or all of the roots. The water must be applied in as even a distribution as possible around the trunk, and in an area within 6 times the DBH of the trunk.

*Timing of Irrigation* The trees ought to be irrigated in the summer months of the construction project between the 1/December and 30/March of each summer.

*Frequency of Irrigation* The water must be applied every three weeks. The amount and frequency will be subject to on going monitoring by Walker Corporation management, or appointees thereof, and will be subject to change.

**DW** the removal of any dead wood or broken branches within the tree canopy, of 50mm diameter and greater

**DW2** the removal of dead wood within the tree canopy of 25mm diameter or larger. This category is mainly reserved for tidying up trees with excessive small dead branchlets on the exterior of the canopy: this work will need to be undertaken using an EWP (Elevated Work Platform)

**CP** Clearance Pruning either away from an existing building or another more important tree

**WR** Weight Reduction: the reduction of one or more limbs where excessive end weight may threaten failure

**Removal** the removal of the entire tree, including grinding out of the stump.

**Cable/Bolt** The installation of appropriate support material in the tree's canopy; this must be carried out by qualified arborists experienced in this process. The amounts and types of materials used, plus the numbers of bolts and cables for each tree must be specified by the tenderer for the works. Preference will be given by management to the use of appropriate strength steel cables, and high tensile steel bolts of no greater than 12mm diameter.

### **General Rules**

All the above mentioned works must be carried out by qualified and experienced arborists and all pruning works must conform to the Australian Standard for Pruning of Amenity Trees (AS 4373:1996), a copy of which is available at [www.standards.com.au](http://www.standards.com.au).

All debris for each tree must be removed from the site within 14 days of the works on any particular tree having commenced. The debris must be left neatly stacked and well clear of any paths or roads or any other positions where it may cause obstruction, nuisance or danger within the 14 days.

The mulch must be dumped in a location on the site as directed by management. The wood is to be removed from the site by the contractor unless otherwise directed.

### **Definitions**

In order to understand the column headings of the table of data below, I have provided the following definitions:

**DBH** diameter of trunk over bark at breast height In a number of cases where the tree has forked into multiple trunks below breast height (1.3-1.5m) the diameter is measured below the fork and an estimate is made for the single trunk equivalent at breast height.

**Condition** This descriptor can be encapsulated by three terms, namely **Health (H)**, **Structure (S)** and **Form (F)**.

Health is largely governed by the ease in which the metabolic functions are occurring throughout the tree. Symptoms of health include the amount, distribution, density, size and colour of the foliage.

Structure refers to the structural stability of the tree and its branches. A well structured tree is not likely to shed branches or stems, or snap in the trunk or blow over, whereas a poorly structured tree is more likely to.

Form basically refers to the symmetry of the tree. A tree with a straight trunk and symmetrical crown and evenly distributed branches is referred to as having good form, whilst a lopsided leaning tree may have fair – poor form.

Each tree has been given a condition rating of either **Good (G)**, **Fair (F)** or **Poor (P)**.

In the cases of the elms, significant internal trunk decay is likely to be occurring in many of them as a result of lopping which they received many years ago. One cannot determine the degree of hollowing without detailed internal trunk probing for each tree. Our condition and WOR ratings therefore do not reflect the status of internal decay in the elms.

#### **Worthiness of Retention (WOR):**

The worthiness of retention of a tree is based on a number of factors. These factors are:

1. structure, health, form and safe useful life expectancy,
2. size, prominence in the landscape,
3. species rarity,

Any tree with a WOR rating of 3 or less should be seriously considered for removal before development begins because it is dead, nearly dead or dangerous, a weed or just of very little significance and readily replaceable with new plantings. Trees rated 4-6 can be retained if desired, but their SULEs may be somewhat limited. Some of these trees may respond to treatments such as formative pruning, removal of dead wood, weight reduction pruning etc. Trees rated 7 or higher are well worthy of retention (the higher the ranking the more so), primarily because of their good health, structure, form, significance and SULE, although they still may need substantial works done on them as already detailed, if they are to be retained.

#### **Root Preservation Zone (RPZ)**

The figures quoted for this column are the minimum distances in metre from the centres of the trunks which should be kept intact from any trenching. The idea of this precaution is to prevent excessive root loss and hence health decline occurring, because the bulk of the roots in the soil at this site are likely to be found between 100mm and 600mm below the ground. If the RPZ is not violated, one can be confident that the health and structural integrity of the tree will not be adversely affected

The figures quoted apply to one side of the tree only. Obviously if the tree is encroached upon from another side it will lose more roots and may not be able to cope. **To account for this, the minimum distance of encroachment should, as a rule of thumb, be increased 15% for each successive side of encroachment.** For example, if the minimum distance is quoted as being 8m, and there is to be excavation on a second side of the tree, there should be no encroachment within 9.2m of the trunk centre on that side. If the tree is to be encroached upon on three sides, the minimum distance has to be lengthened to  $9.2 \times 1.15 = 10.6$ m. If the tree is to be surrounded with excavation, do not excavate for any purpose within  $10.6 \times 1.15 = 12.2$ m.

***The RPZ must be treated as a conservative guide only. It generally will allow for cases where more roots than usual may be emanating in the direction of the proposed trench.***

**The RPZs do not take into account root barrier or impedance effects such as those caused by existing buildings, retaining walls and roads.** For example, it would be safe to assume that root development will be negligible beneath a masonry building with strip footings. Similarly, root development beneath an existing asphalt road a metre beyond the kerb is likely to be very minor, even if this distance is well within the RPZ. Excavation under these circumstances could be assumed to take place without having a negative impact on the safe useful life expectancies of the trees.

Excavation by non root destructive means such as horizontal boring at a depth of greater than 800mm can be assumed to be acceptable when within the RPZs. Alternatively, if it has been found from non root destructive exploratory trenching under arboricultural supervision that no roots of significance are going to be severed in the proposed excavation, then there is no reason why the RPZ cannot be encroached within to the trial trench.

If excavation has to occur to put in a building or retaining wall, in which case the soil volume available for the tree is likely to be permanently reduced, a distance of up to 15% more than the quoted RPZ may be needed, depending on the degree of the permanent reduction in soil availability. An example of where this is required is where the tree is limited in its root spread on three sides by roads, buildings or retaining walls, and the fourth side is cut into.

**Drenching with water of the RPZs must occur soon after any excavation has occurred close to the RPZ.**

### **Minimum Distances for Housing**

If one is serious about the long term retention of any chosen tree, one has to provide sensible minimum distances from them for dwellings to be situated, relative to that tree. For example River Red Gums lend themselves well to weight and hazard reduction pruning, particularly if done by qualified arborists with experience in this matter. However house purchasers will not be happy with rooms sited beneath large limbs or in the paths of leaning trunks. Houses will be difficult to sell if built too close to the trees, irrespective of whether they are River Red Gums or not, and the trees will be difficult to maintain, and difficult and expensive eventually to remove.

Furthermore, if the houses are built too close, severe cutting back of the canopy is likely to occur in the future, thereby debilitating the appeal and probably the useful life expectancy of the tree. Those people who do buy blocks with no alternative but to build dwellings down lean of massive trees, or under long heavy dangerous boughs, are likely to exert a lot of pressure on the future responsible authority to have the tree removed, or severely cut back, before and sometimes after the dwelling has been built. I have therefore provided what I believe, based on many years of experience dealing with trees and people, minimum comfort threshold distances for most people as to how close one can build to the trunk centers. These distances have been provided for each of the four cardinal directions, **North (N), South (S), East (E) & West (W)** from the centre of the trunk of each tree. Buildings such as garages, where people do not live or spend any great length of time, may be able to be built slightly closer than these recommended minimum distances, so long as the RPZs are conformed with.

Roads and driveways again could be constructed substantially closer than the recommended minimum distances for houses, but care will have to be taken to either keep them outside the minimum non violation zones for trenching, or to construct them on the existing grades.

## **General rules for tree management**

1. An arborist will need to be appointed by the property owner/developer prior to commencement of works.
2. The trees to be retained and the trees to be removed must be clearly shown on the plans
3. The following worded sign must be attached to the tree protection fences “Tree Protection Fence” The signs must be weatherproof with large clear professional lettering.
4. A watering regime must be developed as discussed below for the site trees during the November to April periods of construction.

## **Trees to be Retained**

### ***Pre-Demolition Protection***

Fence off the trees to be retained to at least the root preservation zones (RPZs) from the trunk centres wherever possible. If this is impossible, due to site constraints such as lack of pedestrian access or pathways for the ferrying of materials, or the existing or future presence of structures such as buildings, roads, drives, at least protect the trunks with fencing, and mulch to a depth of 150mm outside the fences (where structures or paving is not present) to a radius of at least the RPZs from the trunk centres. Each fence must be at least 1.2m high sturdy high visibility fencing. The fences must remain intact without any fill or rubbish entering them for the life of the project. Only with permission of the consulting arborist can they be removed or shifted within that time.

### ***During Construction Protection***

Maintain as above. Any pruning which is necessary for building or scaffold clearance must be done according to the Australian Pruning Standard AS 4373:1996. Pruning and tree surgery works of trees in stage 1 which have not already been undertaken, as recommended in the table of data and treatment recommendations as listed above, ought to be undertaken at some stage during the construction period.

There must not be any trenching nor level reductions for any purpose within the RPZ from the centre of the tree, unless it has been shown by non root destructive exploratory excavation beforehand, under arboricultural supervision that it is OK to do so. This includes any excavation for drains and services, otherwise it must be done

by non root destructive means. Examples are horizontal boring at greater than 80cm depth or by pneumatic or hydraulic means under arboricultural supervision.

Do not excavate nor reduce levels by more than 10cm for paving within the RPZs of the trunk centres, unless it has been demonstrated by non root destructive exploratory excavation beforehand it is OK to do so.

The trees as already listed in the table of data and treatments, which are prescribed for irrigation, must be irrigated as prescribed.

***Arboricultural Supervision During Construction***

It is recommended the consulting arborist periodically inspect the trees during construction. From the periods between the 1/December and 30/March, inspections should be monthly. Outside of these months, the inspections should be every three months. Make recommendations where necessary.

Yours faithfully,  
GALBRAITH & ASSOCIATES

Rob Galbraith  
B.For.Sci.(Melb.)  
N.C.H. (Arb.)(U.K.)

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings				Maintenance treatments at Jan 2006	RPZ (m)	WOR (1-10)	Plan grid reference
				N	S	E	W				
1	<i>Schinus areira</i>	80	G	6			7	DW	6	7	M 12
2	<i>Cedrus deodara</i>	54		7	5	9	6	DW	5	7	M 12
3	<i>Quercus canariensis</i>	70	G		7		9	DW I	6	8	M 12
3A	<i>Eucalyptus maculata</i>										M 12
3B	<i>Meleuca styphelioides</i>										M 12
4	<i>Quercus canariensis</i>	75	F/G	8	6	7	4	DW I	6	7	M 12
4A	<i>Lagunaria patersonia</i>	23	P	4	3	5	3		2	3	M 12
4B	<i>Arbutus unedo</i>										M 11
5	<i>Cedrus deodara</i>	65		8	6	7	4	DW	6	7	M 11
6	<i>Quercus canariensis</i>	78	G	7	6	6	5	DW	6	7	M 11
7	<i>Quercus canariensis</i>	50	F	4		6	7		4	5	L / M 11
8	<i>Cedrus deodara</i>	52	G	6	6	5	5	DW I	4.5	7	L 11
8A	<i>Schinus areira</i>	60	F	6	5	5	8	Prune	5	6	L 11
9	<i>Quercus canariensis</i>	65	G	7		8	7		6	7	L 11
10	<i>Prunus ilicifolia</i>	70	G	7	7	7	6		7	9	L 11
11	<i>Quercus robur</i>	57	F	6		6	5	DW I	5	5	L 11
12	<i>Eucalyptus camaldulensis</i>	58	G	8	6	10	5	DW	7e/4w	7	L 11
13	<i>Cedrus deodara</i>	37	G	4	7	5	4	DW	3.5	5	L 11
14	<i>Quercus canariensis</i>	74	G	8		6	8		7	7	L 11
15	<i>Quercus canariensis</i>	58	G	8		9	7	DW2 I	6	7	L 10
18	<i>Quercus canariensis</i>	77	G	10		9	8	CP Prune	7	8	L 12 / 11
19	<i>Ulmus procera</i>	78	F	8	8	9	8		6	7	L / K 11
20	<i>Quercus canariensis</i>	63	F	6		7	8	DW2 I	6	4	K 11
21	<i>Corymbia maculata</i>	25	F/G	4		4	3		2	4	K 11
22	<i>Corymbia maculata</i>	45	G	5		6	5		4	Neighbouring tree	K 11

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 1 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings				Maintenance treatments at Jan 2006	RPZ (m)	WOR (1-10)	Plan grid reference
				N	S	E	W				
23	Pinus pinaster	55	F/G	6	4	6			6	Neighbouring tree	K11
24	Quercus canariensis	60	G	7	9	6			6	7	K 11
25	Ulmus procera	65	G	9	6	6	8		6	7	K 11
26	Ficus macrophylla	32	F	4	5	6	4		3	5	K 11
27	Pinus canariensis	62	G		7	7	7		6	8	K 11
28	Quercus canariensis	57	G	8		7	7		6	7	K 11
29	Ulmus procera	83	F	9	5	8	8	DW	6	7	K 11
30	Quercus canariensis	75	G	9		8	10		7	8	K 11
31	Ulmus procera	100	F/G	8	7	11	9	DW	7	8	J 11
32	Quercus canariensis	60	F	7		8	6	DW2 I	5	5	J 11
33	Quercus canariensis	60	G	7	9	7	7		5	7	K 11
34	Quercus canariensis	55	G	7	8	6	7	DW	5	7	K 11
35	Quercus canariensis	52	G	9	7	6	6		5	7	K 10/ 11
35A	Eucalyptus leucoxylon	18	F	4	4	4	4		2	4	K 10
36	Ficus macrophylla	36	F	4	4	4	5	I	4	4	K 11
37	Ficus macrophylla	44	F	6	6	10	3		4	5	J / K 11
38	Cupressus macrocarpa	120	P	8	9	10	10		8	1	J 11
39	Quercus canariensis	65	G	9	4	7	9	DW	6	7	J 10/ 11
40	Ulmus procera	57	F	5	6	5	8	DW I	5	4	J 11
41	Quercus robur	45	P		6	3	7	DW I	5	3	K 10
42	Pinus radiata	120	P	11	10	11			9	2	K 10
43	Quercus robur	48	P		6	4	8	DW	4	3	K 10
44	Quercus robur	43	G	7		8	6	I	4	7	K 10
45	Quercus robur	58	G		9	8	7		5	7	J 10
49	Ulmus procera	81	F/G	7	7	8	9	DW	5.5	8	J 11

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 2 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings				Maintenance treatments at Jan 2006	RPZ (m)	WOR (1-10)	Plan grid reference
				N	S	E	W				
50	<i>Ulmus procera</i>	66	F/G	7	7	8	8	DW	6	7	J 11
51	<i>Quercus canariensis</i>	66	F	8	7	7	8	DW2I	6	6	J 10
51A	<i>Quercus canarensis</i>	50	G	7	7	6	6	DW I	5	7	J 10/ 11
52	<i>Quercus canariensis</i>	54	G	8	8	7	7	DW	5	7	J 10
52A	<i>Cupressus torulosa</i>	46	F	3	5	4	4		3.5	6	J 11
53	<i>Quercus canariensis</i>	68		7	10	7			5.5	7	I 10
53A	<i>Leptospermum petersonii</i>	12	P	3	3	3	2		1.5	2	J 10
53B	<i>Hakea suaveolens</i>	20	F/P	4	3	4	2		2	2	J 11
54	<i>Ulmus procera</i>	90	F/G	8	6	8	8	DW I	6	7	I 11
55	<i>Ulmus procera</i>	62	F/G	7	7	7	7	DW I	5	7	I 11
55A	<i>Ficus macrophylla</i>	28	F	4	4	3	3		2	4	I 11
56	<i>Quercus canariensis</i>	66	G	8		7	8	DW	5.5	7	I 11
56A	<i>Quercus canariensis</i>	69	F/G	9		7	8	DW I	6	7	J 11
57	<i>Quercus canariensis</i>	59	G	7		7	6	DW	5	8	I 11
58	<i>Quercus canariensis</i>	65	G	9		8	9	DW	6	7	I 11
59	<i>Quercus canariensis</i>	65	G	8		6	9	DW	6	8	I 11
60	<i>Ulmus procera</i>	85	F/G	8	5	9	9	DW I	6	7	I 11
61	<i>Quercus canariensis</i>							DW2I			I 10
62	<i>Ficus macrophylla</i>	45	G	6	7	8	7		4	6	I 10 / 11
63	<i>Quercus canariensis</i>	54	G	8	8	7	7	DW	4.5	7	I 10
64	<i>Eucalyptus cladocalyx</i>	80	F	9	9	8	9		6	5	I 10
65	<i>Cupressus torulosa</i>	50	F/P	3	4	4	4		4	4	I 10
66	<i>Quercus canariensis</i>	53	F	7	8	8	6	I	4.5	7	H 10
67	<i>Ulmus procera</i>	39	F	7	4	6	5	DW I	3.5	5	I 10
68	<i>Pinus radiata</i>							DW			H 10

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
Page 3 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings				Maintenance treatments at Jan 2006	RPZ (m)	WOR (1-10)	Plan grid reference
				N	S	E	W				
69	Cupressus torulosa	47	F	3	4	4	4		4	7	H 10
70	Quercus canariensis	65	G	10	8	7	9		5.5	7	H 10
71	Quercus canariensis	62	P	7	7	7	7	DW I	6	2	H 10
72	Ulmus procera	59	P	9	4	4	8		6	2	H 10
73	Quercus canariensis	59	G	10	8	7	9		5	8	H 10
74	Cupressus torulosa	41	F	3	3	3	3		4	7	H 10
75	Quercus canariensis							DW I			H 10
76	Quercus canariensis	50	G	9	8	7	8		5	7	G 10
78	Cupressus torulosa	44	F/G	3	4	3	4		4	7	G 10
79	Quercus canariensis	70	G	10	7	8	10	DW I	6	8	G 10
80	Cupressus torulosa	38	F/G	3	4	4	4		4	7	G 10
82	Ulmus procera	84	F	8	5	8	9	DW I	5.5	7	I 11
84	Quercus canariensis	78	G	9		10	8	DW	6.5	8	H 11
85	Quercus canariensis	53	G	8		6	6	DW	4.5	7	H 11
86	Quercus canariensis	68	G	10		9	8	DW	5.5	8	H 11
87	Quercus canariensis	72	F	7		7	10	DW I	6	5	H 11
88	Ulmus procera	81	F	8	6	8	8		5.5	7	H 11
89	Ulmus procera	75	F	8	8	9	8	DW	5.5	7	H 11
90	Ulmus procera	76	F	7	6	8	8	DW I	5.5	7	G 11
91	Quercus canariensis	64	G	9		9	6		5.5	8	G 11
92	Quercus canariensis	85	G	10		8	9	DW	6	8	G 11
93	Quercus canariensis	56	F	9		5	6	DW	4.5	6	G 11
94	Ulmus procera	72	F	7	6	7	8	DW I	5	6	G 11
95	Quercus canariensis	66	F/G	8		7	6	DW	5	7	G 11
96	Quercus canariensis	74	F/G	8		8	7	DW	6	7	F 11

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 4 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings				RPZ (m)	WOR (1-10)	Plan grid reference
				N	S	E	W			
97	<i>Quercus canariensis</i>	80	G	10		8	7	DW	6	8
98	<i>Ulmus procera</i>	87	F	8	6	9	8	DW I	5	5
99	<i>Quercus canariensis</i>	93	G	10		8	9	DW	6.5	8
101	<i>Ulmus procera</i>	75	F	7	6	7	7		6.5	6
103	<i>Ulmus procera</i>	44	F	6	6	6	6	DW I	3.5	5
127	<i>Cupressus torulosa</i>	41	F/G	3	4	4	3		3	7
128	<i>Grevillea robusta</i>	30	P	4	4	4	5		3	3
133	<i>Ficus macrophylla</i>	29	F	4	7	6	5	DW I	2.5	5
134	<i>Cupressus macrocarpa</i>								4	F 10
134B	<i>Quercus canariensis</i>	52	P	7	6	8	5		4	3
134C	<i>Grevillea robusta</i>								4	F 10
136	<i>Quercus canariensis</i>	70	G	7	8	6	8		6	E 10
136A	<i>Quercus canariensis</i>	32	P	5	3	5	5		3	F 10
142	<i>Quercus canariensis</i>								2	C 10
149	<i>Pinus canariensis</i>									C / D 10
153	<i>Pinus roxburghii</i>							I		C 10
156	<i>Pinus radiata</i>									B 10
157	<i>Eucalyptus radiata</i>									B 10
158	<i>Araucaria cunninghamii</i>									B 10
160	<i>Brachychiton populneum</i>									B 10
160B	<i>Laurus nobilis</i>									
161	<i>Ficus macrophylla</i>									A 10
162	<i>Ulmus procera</i>									A 10
163	<i>Ficus macrophylla</i>									A 9
171A	<i>Araucaria cunninghamii</i>							I		

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 5 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings N S E W	RPZ (m)	WOR (1-10)	Plan grid reference
							Maintenance treatments at Jan 2006
172	Araucaria bidwillii						C 9
176	Araucaria bidwillii						C 9
180	Cedrus atlantica				DW2 I		C 9
185	Pinus canariensis				DW		B 9
186	Pinus radiata						B 9
189	Pinus canariensis						B 9
190	Araucaria bidwillii						B 9
191	Pinus canariensis						A 9
193	Araucaria cunninghamii						A 9
197	Araucaria bidwillii						A 8
198	Ficus macrophylla						A 8
199	Ficus macrophylla						A 8
215	Pinus canariensis				DW		B 8
216	Araucaria cunninghamii				I		B 8
217	Cedrus deodora				DW		B 8
218	Brachychiton hybrida				I		B 8
222	Ficus macrophylla						A 8
224	Pinus radiata						A 8
225	Pinus radiata				DW		A 8
226	Pinus radiata				DW		A 8
228	Ficus macrophylla				DW		A 8
230	Quercus canariensis						A 8
231	Pittosporum undulatum						A 7
232	Quercus canariensis						A 7

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 6 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings				RPZ (m)	WOR (1-10)	Plan grid reference
				N	S	E	W			
233	Pittosporum undulatum									A 7
234	Quercus canariensis									A 7
235	Pinus radiata							DW -cable		B 7
236	Quercus canariensis									B 7
237	Pinus radiata									B 7
238	Pinus radiata									B 7
242	Casuarina glauca						I			C 6
245	Pinus radiata									C 6
245A	Ficus macrophylla						I			C 6
246	Eucalyptus occidentalis							Crown reduction		C 6
247	Eucalyptus cornuta							DW		C 6
248	Pinus radiata							DW		C 6
250	Ficus macrophylla							DW		D 5
251	Ficus macrophylla							DW		D 5
253	Pinus radiata							DW		D 5
254	Pinus radiata		Dead							D 8 Dead
255	Ficus macrophylla									D 8
256	Ficus macrophylla									E 8
281	Ulmus procera							DW		F 6
282	Ulmus procera							DW CP		F 6
287	Quercus canariensis	58	G	8	7	6		4	7	H 7
288	Quercus canariensis	75	G	8	8	8	CP	5.5	7	H 7
289	Quercus canariensis	54	F/P		6	5	7	I	4	H 8
291	Quercus canariensis	66	G	9	8	8		5.5	7	I 8
292	Quercus robur	48	P		6	5	5		4	I 8

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 7 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings				Maintenance treatments at Jan 2006	RPZ (m)	WOR (1-10)	Plan grid reference
				N	S	E	W				
293	Quercus canariensis	77	F	11	-	9	8	DW2 I	6	4	I 8
294	Quercus canariensis	67	G		10	10	8		6	7	I 8
295	Pinus muricata	85	F	7	7	6	8	I	8	9	H 9
296	Quercus canariensis	100	G	-	9	10	9	DW	8	9	F 8
297	Quercus canariensis	80	G	7	-	9	7	DW	7	8	F 8
297A	Fraxinus angustifolia										F 8
298	Prunus illicifolia	multi stemmed	F	-	7	7	7		4	5	F 8
299	Quercus robur	52	F		7	7	7	I	4	5	I 9
301	Quercus canariensis	73	G		8	7	8	I	6	7	J 8
302	Quercus canariensis	60	G		7	7	6	I	5	7	J 8
303	Quercus canariensis	68	G	8		9	8		5.5	7	I 8
304	Quercus robur	47	F	6		6	6	I	3.5	5	J / I 8
305	Eucalyptus camaldulensis	105	F	9	8	10	8		8	5	J 8
306	Corymbia citriodora	52	F	7		6	9		4.5	5	J 9
308	Eucalyptus leucoxylon	32	F	6		6	6		3	5	J 9
309	Corymbia maculata	56	F/G	8	8	7	7		5	6	J 9
311	Eucalyptus camaldulensis	140	G	14	11	10	1		10	9	M 9
313	Eucalyptus camaldulensis	100	G	10	11	9	9		4.5	8	L 9
314	Eucalyptus robusta	27	F	4	5	4	5	I	2.5	4	L 8
315	Eucalyptus camaldulensis	18	G	4	4	4	4	Possum Isolation	2	5	L 8
316	Eucalyptus camaldulensis	140	G	12	13	10	1		9	9	L / M 8
317	Eucalyptus camaldulensis	23	P	4	4	4	4		2.5	1	L 8
318	Eucalyptus camaldulensis	57	G	6	8	6	8		6	7	L 7
319	Eucalyptus camaldulensis	120	G	8	13	8	13		10	8	M 7
320	Eucalyptus camaldulensis	120	G	12	12	11	12		10	8	M 7

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
Page 8 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings				RPZ (m)	WOR (1-10)	Plan grid reference
				N	S	E	W			
321	<i>Eucalyptus camaldulensis</i>	140	G	14	8	16	DW WR	11	9	N 2 / 3
330	<i>Cupressus macrocarpa</i>								3	H 9
331	<i>Pinus radiata</i>								2	H 9
332	<i>Angophora costata</i>									H 9
333	<i>Casuarina cunninghamii</i>									
334	<i>Casuarina glauca</i>									
335	<i>Allocasuarina littoralis</i>							4		H 9
336A	<i>Eucalyptus globulus</i>									H 8
336B	<i>Eucalyptus globulus</i>									H 8
336C	<i>Eucalyptus globulus</i>									H 8
337	<i>Lophostemon confertus</i>						DW		4	H 8
338	<i>Lophostemon confertus</i>								5	H 8
339	<i>Eucalyptus kitsoniana</i>									H 9
340	<i>Eucalyptus globulus</i>						DW			H 9
341	<i>Eucalyptus goniocalyx</i>	32	F	4	6	4		3	5	H 7
342	<i>Fraxinus angustifolia</i>	20	F-P		3	4	4	DW2	2	H 7
343	<i>Fraxinus angustifolia</i>	26	F		6	4	4		2	H 7
344	<i>Betula pendula</i>									G 7
345	<i>Eucalyptus globulus</i>									G 7
346	<i>Fraxinus angustifolia</i>									G 7
347	<i>Eucalyptus haemastoma</i>									G 7
348	<i>Fraxinus angustifolia</i>									G 7
349	<i>Fraxinus angustifolia</i>									G 7
350	<i>Quercus robur</i>						DW I		5	G 6
351	<i>Lophostemon confertus</i>									G 6

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 9 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings N S E W	Maintenance treatments at Jan 2006	RPZ (m)	WOR (1-10)	Plan grid reference
351A	Acmena smithii							G 6
352	Leptospermum petersonii							G 6
352A	Cotoneaster glaucophyllus							G 6
352B	Buddleja salvifolia							G 6
353	Fraxinus angustifolia					5		G 7
354	Fraxinus angustifolia					4		G 7
357	Arbutus unedo					4		F 5
358	Populus simonii					4		E 5
359	Populus simonii					4		E 5
360	Populus simonii					4		E 5
361	Populus alba					5		E 5
367A	Allocasuarina littoralis							D 5
367B	Allocasuarina littoralis							D 5
369	Eucalyptus botryoides							D 5 Dead
370A	Eucalyptus sideroxylon							D 5 Dead
370B	Eucalyptus sideroxylon							D 5
370C	Eucalyptus sideroxylon							D 5
371	Grevillea robusta					4		D 5
372	Melaleuca styphelioides					4		D 5
374	Fraxinus angustifolia							E 4
375	Liquidambar styraciflua					6		E 4
376	Liquidambar styraciflua					6		E 4
377	Liquidambar styraciflua					6		F 4
378	Liquidambar styraciflua					6		F 4
379	Liquidambar styraciflua					6		F 4

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 10 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings				RPZ (m)	WOR (1-10)	Plan grid reference
				N	S	E	W			
380	Cupressus torulosa									F 4
381	Fraxinus angustifolia									F 7
381A	Arbutus canariensis								3	E 7
381B	Arbutus canariensis								3	F 8
382	Melaleuca quinquenervia								4	G 8
383	Casuarina glauca								5	F/G 8
384	Casuarina glauca								4	F 8
385	Fraxinus angustifolia									E 7
386	Cupressus macrocarpa 'Aurea'	80	F	6	6	6	6	5	5	E 6
387	Liquidambar styraciflua	32	F/G	5	5	5	5	3.5	5	E 6
388	Prunus ilicifolia	25 multi stemmed	F	5	4	3	4	Remove	3	E 6
								shrubby undergrowth (Duranta)		
389	Liquidambar styraciflua								5	D 6
390	Eucalyptus spathulata								4	D 7
391	Eucalyptus leucoxylon								3	D 6
392	Eucalyptus leucoxylon								3	D 6
393	Acacia elata								3	D 7
394	Pittosporum eugeniodes 'Variegatum'								3	C 7
396	Lophostemon confertus								5	D 7
397	Eucalyptus globulus								3	D 7
398	Cedrus deodara							DW	6	D 7
399	Acacia prominens								5	D 7
400	Eucalyptus maculata								2	D 7
401	Acacia prominens								2	D 7
403	Fraxinus angustifolia								3	E 7

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
Page 11 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings				RPZ (m)	WOR (1-10)	Plan grid reference
				N	S	E	W			
404	Cupressus macrocarpa							4	E 7	
405	Cupressus macrocarpa							5	E 7	
406	Cupressus macrocarpa							4	E 8	
407	Pinus canariensis						DW	7	D 7	
407A	Fraxinus angustifolia							6	E 8	
408	Melaleuca styphelioides							4	E 8	
409	Acacia implexa						DW Bolt and Cable	8	E 8	
410	Fraxinus robusta							5	E 8	
411	Melaleuca styphelioides						CP	5	E / F 9	
412	Acmena smithii								F 9	
413	Lagunaria pattersonii							5	F 9	
414	Eucalyptus maculata								F 9	
415	Eucalyptus maculata							6	F 9	
416	Salix chilensis								F 8	
417	Leptospermum pannosum								F 9	
418	Ficus macrophylla	50	P	6	3	6	6	I	4.5	3
420	Melaleuca armillaris								3	D 10
422	Ulmus procera								5	D 10
423	Ulmus procera								6	D 10
424	Pittosporum undulatum								4	D 10
425	Lophostemon confertus								4	D 10
427	Pittosporum undulatum								4	D 10
428	Lagunaria pannosum								4	D 10
429	Ficus macrophylla								3	D 9
430	Lagunaria pannosum								3-4	D 9

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
Page 12 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings N S E W	RPZ (m)	WOR (1-10)	Plan grid reference	Maintenance treatments at Jan 2006
431	Eucalyptus maculata					6	D 9	
432	Eucalyptus maculata					4	D 9	
433	Melaleuca styphelioides					3	D 9	
434	Eucalyptus maculata						D 9	
435	Calitris gracilis/glaucophylla				DW2 I Bolt	6	D 9	
436	Quercus canariensis68					3	D 9	
439A	Ligustrum lucidum					3	C 8	
439B	Ligustrum lucidum						C 8	
440	Melaleuca armillaris					3	C 8	
441	Hakea suaveolens					3	C 8	
441A	Callitris rhomboidea						C 8	
442	Melaleuca armillaris					3	C 7	
443	Lophostemon confertus					6	C 7	
444	Ficus macrophylla					6	B 7	
445	Pittosporum undulatum					3	B 6	
451	Pinus radiata				DW		B 7	
452	Acacia implexa				DW	7	B 7	
455	Cupressus torulosa	39				6-7	B 8	
455A	Cupressus torulosa					1 (dead)	B 8	
456	Cienfugosia patersonii	15,23				4	B 8	
457	Fraxinus angustifolia	39				5	B 8	
458	Jacaranda mimosifolia					6-7	B 8	
459	Acacia mearnsii						C 8	
460	Eucalyptus leucoxylon					2	E 9	
461	Eucalyptus botryoides					4	E 9	

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 13 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings N S E W	Maintenance treatments at Jan 2006	RPZ (m)	WOR (1-10)	Plan grid reference
462	Lophostemon confertus					3-4	E3	
463	Quercus robur				DW2 I	6-7	D / E 3	
465	Eucalyptus nicholii					5	D 2	
467	Lophostemon confertus					4	D 2	
469	Casuarina glauca					5	D / E 2	
470	Eucalyptus maculata					4	D 2	
471	Lophostemon confertus					4	D 2	
472	Callistemon rugulosus					4	D 2	
473	Salix matsudana "pekinensis"					5	D / E 3	
474	Agonis flexuosa						E 3	
475	Eucalyptus camaldulensis						E 3	
477							F 4	
479	Fraxinus angustifolia					6	F 3	
480	Fraxinus angustifolia					4	F 3	
481	Fraxinus angustifolia					4	F 3	
482	Fraxinus angustifolia					2	F 3	
484	Eucalyptus cinerea					5	F 2	
486	Eucalyptus viminalis				DW -remove ivy	5	F 2	
487	Eucalyptus viminalis					5	F 1	
488	Gleditsia tricanthos					4	G 1	
489	Casuarina glauca					4	G 1	
490	Eucalyptus citriodora				I	4	G 1	
495	Eucalyptus viminalis						G 2	
497	Melaleuca armillaris					3	G 2	
498	Eucalyptus saligna				DW	4	G 3	

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 14 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings N S E W	Maintenance treatments at Jan 2006	RPZ (m)	WOR (1-10)	Plan grid reference
500	Eucalyptus nicholli					4	G 3	
501	Lophostemon confertus					4-5	H 3	
502	Lophostemon confertus					5	H 3	
503	Casuarina glauca					5	H 3	
504	Eucalyptus nicholli					3	H 3	
505	Grevillea robusta					6	H 2	
508	Eucalyptus nicholli					2	H 2	
510	Eucalyptus nicholli					5	H 2	
511	Eucalyptus nicholli					4	H 2	
512	Eucalyptus nicholli					4	H 2	
513	Acacia pycnantha					3	H 2	
514	Eucalyptus melliodora					3	H 1	
516	Eucalyptus maculata						H 1	
517	Eucalyptus maculata						H 1	
518	Eucalyptus maculata						H 1	
519	Eucalyptus maculata						H 1	
520	Eucalyptus maculata						H 1	
521	Eucalyptus leucoxylon					5	I 1	
522	Eucalyptus camaldulensis					4	I 1/2	
523	Eucalyptus leucoxylon					4	I 2	
524	Eucalyptus leucoxylon					4	J 2	
525	Eucalyptus bicostata					4	I 3	
526	Melaleuca styphelioides					4	I 3	
527	Melaleuca styphelioides					4	H 3	
529	Melaleuca styphelioides					4	I 3	

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 15 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings				RPZ (m)	WOR (1-10)	Plan grid reference
				N	S	E	W			
533	Eucalyptus nicholii									I 4
534	Eucalyptus nicholii							CP		I 4
535	Ulmus minor 'Variegata'									
536	Eucalyptus globulus							DW CP		I 4
537	Melaleuca linariifolia									I 4
538	Eucalyptus bicostata								3	J 3
539	Eucalyptus camaldulensis								5-6	J 3
540	Eucalyptus bicostata								4	J 3
541	Grevillea robusta								4	J 3
545	Eucalyptus macrandra									K 4
546	Eucalyptus maculate	45	G	6	7	6	6	4	6	K 4
548	Eucalyptus maculate	60	G	6	8	6	8	6	6	K 4
551A	Eucalyptus nicholii	50	F-G	6	6	6	6	4.5	5	J 5
553	Eucalyptus maculate	52	G	7	8	8	7	4.5	6	K 5
554	Eucalyptus maculate	35	G	5	5	5	6	3	6	J 5
555	Eucalyptus maculate	32	G	4	4	4	5	2.5	6	J 5
556	Eucalyptus maculate	49	G	6	7	6	8	4.5	6	J 5
556A	Eucalyptus nicholii	40	P	5	5	4	5	3	3	J 5
556B	Gleditsia tricanthos	17	F/P	3	3	3	3	1.5	3	
557	Melaleuca styphelioides								4	J 5
558	Melaleuca styphelioides								4	J 5
559	Eucalyptus citriodora									I 5
560	Eucalyptus nicholii									I 5
563	Eucalyptus melliodora								4	G 3
564	Lophostemon confertus								5	G 3

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
Page 16 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings				RPZ (m)	WOR (1-10)	Plan grid reference
				N	S	E	W			
565	Eucalyptus globulus									G 3
566	Eucalyptus globulus							5		G 4
567	Eucalyptus globulus							5		G 4
568	Acacia dealbata									G 4
570	Fraxinus angustifolia									H 5
575	Melaleuca armillaris							3		G 6
575A	Wigandia caracasana							4		G 6
576	Allocasuarina verticillata	40	F	4	4	4	4	2.8	5	H 6
576A	Acacia baileyana	18	F	2.5	2.5	2.5	2.5	2	3-4	H 6
584	Eucalyptus camaldulensis	25	G	5	5	5	5	2	5	I 7
587	Eucalyptus ficifolia	45	F/G	4	7	4	4	4	5	J 6
588	Eucalyptus citriodora	50	G	8	7	8	7	5	6	J 7
588A	Eucalyptus maculate	21	G	4	4	4	4	2	4	J 7
589	Eucalyptus maculata	22	F/P	8	7	8	7	2	4	J 7
590	Eucalyptus maculate	33	F/G	4	4	4	4	2	4	J 7
591	Grevillea robusta	25	G	4	4	4	4	2	4	J / K 7
593	Eucalyptus maculata	23	G	4	4	4	4	2	5	H 7
593A	Eucalyptus cladocalyx 'Nana'	21	G	4	4	4	4	2	4	H 7
594	Eucalyptus maculata	20	G	4	4	4	4	2	4	I 9
600	Pinus canariensis	55	G				7	6	9	M 10
	Pinus canariensis	53	G				7	6	9	M 10
600	Pinus canariensis	68	G				7	6	9	M 10
	Pinus canariensis	58	G				7	6	9	M 10
	Pinus canariensis	63	G		7		7	6	9	M 10
601	Pinus canariensis (x4)	50-60	G				6	6	9	N

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
Page 17 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings				W	RPZ (m)	WOR (1-10)	Plan grid reference
				N	S	E	Maintenance treatments at Jan 2006				
602	Pinus canariensis (row)	40-60	G				6	6	9	N 3 / 4	
602A	Pinus radiata	40-60	G				6	6	9	N 3 / 4	
603	Quercus canariensis						DW2 I		7	D 3	
604	Quercus robur								7	D 3	
606	Eucalyptus camaldulensis								7	D 2	
607	Eucalyptus camaldulensis								7	F 3	
608	Eucalyptus melliodora	65	G	4	11	10	7	6	9	J 9	
609	Eucalyptus camaldulensis								7	H / 11	
610	Eucalyptus camaldulensis								7	H 2	
619	Eucalyptus botryoides	75	P	5	9	-	8	DW WR	6	2	M 10 / 11
620	Melaleuca styphelioides	27	F	3	3	3	3		2	4	M 10
621	Pinus radiata	67	F	6	6	-	9		5	5	M 10
621A	Syncarpia glomulifera								3		M 10
622	Eucalyptus camaldulensis	25	G	4	4	4	4		2	5	M 10
623	Eucalyptus maculata	46	G	6	6	6	6		4	6	L / M 10
623B	Eucalyptus globulus	50	P	6	6	6	6		4	2	L 10
623C	Lophostemon confertus								3		L 10
623D	Eucalyptus camaldulensis	16	F	4	4	4	4		1.5	4	L 10
624	Eucalyptus camaldulensis	30	G	4	4	4	4		2.5	6	L 10
625	Callitris endlicheri		F	3	3	3	3		2.5	4	L 10
626	Melaleuca quinquenervia		F	1.5	1.5	1.5	1.5		1	3	L 10
627	Eucalyptus camaldulensis	23	P	4	4	4	4		2	3	L 9
628	Eucalyptus camaldulensis	19	G	4	4	4	4		2	5	L 10
630	Eucalyptus botryoides	65	P	6	6	6	6	DW	4.5	2	L 9
641a	Eucalyptus camaldulensis	10	P						1		L 8

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 18 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings				RPZ (m)	WOR (1-10)	Plan grid reference
				N	S	E	W			
641b	Eucalyptus camaldulensis	12	P						2	L 8
641c	Eucalyptus camaldulensis	18	P						1	L 8
641d	Eucalyptus camaldulensis	13	P						2	L 8
641e	Eucalyptus camaldulensis	7	P						1	L 8
641f	Eucalyptus camaldulensis	15	P						1	L 8
641g	Eucalyptus camaldulensis	30	G						5	L 8
642	Eucalyptus nicholii	85	P						2	L 8
650	Eucalyptus maculata	35	G	6	6	5	6	3	5	K 6
654	Eucalyptus maculata	45	G	7	6	6	7	4	6	K / L 6
656	Eucalyptus maculata	50	F	7	7	6	7	4	5	L 6 / 7
657	Eucalyptus citriodora	40	G	6	6	6	6	3.5	6	L 6
659	Eucalyptus maculata	58	F	8	7	7	7	DW	5	L 7
660	Eucalyptus maculata	35	G	6	6	6	6	DW	3	L 6
660A	Lagunaria pattersoni		P	3	3	3	3		2	L 6
661	Eucalyptus cornuta	40	P	4	6	3	7		3	M 6
662	Eucalyptus cornuta	48	P	6	4	4	7		4	M 6
679	Eucalyptus occidentalis	45	F	5	4	4	5	3.5	5	M 5
679A	Fraxinus angustifolia	30	F	4	4	4	4		2.5	3
680	Eucalyptus occidentalis	44	P	5	6	5	6	3.5	1	M 5
681	Eucalyptus cladocalyx 'Nana'	60	F/P	5	7	7	5	4.5	4	M 5
682	Eucalyptus cladocalyx 'Nana'	42	F	5	5	5	5		3.5	5
683	Eucalyptus cladocalyx 'Nana'	45	P	6	4	5	5		3.5	3
683A	Eucalyptus cladocalyx 'Nana'		P					DW		M 5
684	Eucalyptus maculata		P						3	M 5
684A	Eucalyptus ficifolia	22	P	2	3	3	3		2	M 5

**KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11**

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 19 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings				Maintenance treatments at Jan 2006	RPZ (m)	WOR (1-10)	Plan grid reference
				N	S	E	W				
695	Melaleuca styphelioides										M 4
686	Eucalyptus maculata	45	F/P	7	6	7	7		4	4	M 4
691	Melaleuca styphelioides		F	4	4	4	4		2.5	4	L 3
694	Melaleuca styphelioides										L 3
695	Eucalyptus nicholii	37	G	4	4	4	4		3.5	5	L 3
695a	Melaleuca armillaris	35	P							2	L 3
703	Casuarina cunninghamii									5	L 3
704	Casuarina cunninghamii									3	L 3
705	Casuarina cunninghamii									4	L 3
706	Casuarina cunninghamii										L 2
708	Casuarina cunninghamii									5	L 2
709	Eucalyptus maculata										M 3
710	Eucalyptus botryoides	35	G	6	6	6	6		3.5	5	M 3
711	Casuarina cunninghamii	28	F/P	4	4	4	4		2	4	M 3
712	Eucalyptus maculata	60	G	7	8	7	7		5	6	M 3
714	Eucalyptus cladocalyx	80	F/G	7	7	7	7	DW WR	6	7	N 3
729	Eucalyptus gomphocephala										N 5
730	Eucalyptus nicholii										N 5
731	Eucalyptus saligna										N 6
732	Melaleuca armillaris										N 6
733	Melaleuca armillaris		P	4	3	3	4		2.5	2	N 7
734	Photinia "Robusta"										N 7
735	Photinia "Robusta"										N 7
736	Pittosporum undulatum		F						2	2	N 6
737	Melaleuca bracteata30		F	3	3	3	3		2.5	4	N 6

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
Page 20 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings N S E W	Maintenance treatments at Jan 2006	RPZ (m)	WOR (1-10)	Plan grid reference
738	Eucalyptus maculata						M 6	
744	Banksia integrifolia	26, 25	G		4	4	6	N 7
757	Callitris rhomboidea							I 10
757A	Grevillea robusta							I 10
758A	Acacia melanoxylon							J 10
758B	Acacia melanoxylon							J 10
758C	Acacia melanoxylon							J 10
759	Acacia melanoxylon							J 9
760	Eucalyptus cladocalyx							J 9
761	Acacia melanoxylon							J 9
762	Eucalyptus leucoxylon							I 9
763	Eucalyptus melliodora							I 9
764	Eucalyptus globulus							I 9
765	Eucalyptus conferruminata							I 9
766	Eucalyptus conferruminata							I 9
768	Lophostemon confertus					5		H 9
769	Lophostemon confertus							I 9
770	Eucalyptus camaldulensis							I 9
771	Fraxinus angustifolia							H 9
772	Fraxinus americana							I 9
773	Platanus x acerfolia							H 9
776A	Eucalyptus maculata							G 10
776B	Eucalyptus maculata							G 10
776C	Eucalyptus maculata							H 10
777	Melaleuca styphelioides					4		G 10

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 21 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings				RPZ (m)	WOR (1-10)	Plan grid reference
				N	S	E	W			
778	<i>Fraxinus angustifolia</i>							6	G 9	
779	<i>Leptospermum petersonii</i>								G 9 / 10	
784	<i>Melaleuca styphelioides</i>	50	F	4	4	4	4	3	4	K 8
785	<i>Eucalyptus robusta</i>	50	F	7	7	7	7	4.5	4	K 8
786	<i>Eucalyptus robusta</i>	40	F	7	7	7	7	4	4	K 8
787	<i>Eucalyptus citriodora</i>	42	F	7	6	6	8	4	5	K 9 / 8
787a	<i>Eucalyptus citriodora</i>	32	P	5	5	5	5	2.5	3	L 9
788	<i>Eucalyptus maculata</i>	36	G	5	5	5	5	3	5	L 8
789	<i>Eucalyptus camaldulensis</i>	23	G	4	4	3	5	2	5	L 8
791	<i>Lophostemon confertus</i>	27	F	4	4	4	4	2.5	4	J 8
792	<i>Eucalyptus maculata</i>	51	F	7	7	7	7	4	5	J 8
793	<i>Eucalyptus nicholii</i>	38	F	6	6	6	6	3.5	5	J 8
806	<i>Melaleuca styphelioides</i>								N 10	
822	<i>Calodendrum capense</i>								J 10	
823	<i>Acacia melanoxylon</i>								J 10	
825	<i>Eucalyptus sideroxylon</i>								I 9	
826	<i>Eucalyptus sideroxylon</i>								I 9	
827	<i>Fraxinus angustifolia</i>								I 9	
828	<i>Acacia implexa</i>								I 9	
829	<i>Acacia melanoxylon</i>								I 9	
830	<i>Grevillea robusta</i>								I 9	
831	<i>Grevillea robusta</i>								I 10	
832	<i>Ulmus procera</i>								F 10	
833	<i>Fraxinus macrophylla</i>								F 10	
834	<i>Fraxinus angustifolia</i>								I 8	

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 22 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings N S E W	RPZ (m)	WOR (1-10)	Plan grid reference
							Maintenance treatments at Jan 2006
835	Acacia melanoxylon						H / 18
837	Allocasuarina littoralis						H 9
838	Angophora costata						H 9
840	Agonis flexuosa						F 10
841	Betula pendula						F 9
842	Agonis flexuosa						E 8
843	Pittosporum "Garnettii"						E 8
844	Eucalyptus botryoides						E 9
845	Myoporum insulare						E 9
846	Fraxinus angustifolia						E 8
847	Cotoneaster glaucophyllus						E 8
848	Cupressus macrocarpa						E 7
849	Fraxinus ornus						E 7
850	Cotoneaster glaucophyllus						H 7
851	Melaleuca styphelioides						H7
852	Melaleuca styphelioides						H7
853	Acer negundo						H 7 / 8
854	Eucalyptus gomphocephala						I 6
855	Eucalyptus macarthurii						I 5
856	Cupressus macrocarpa "Aurea"						H 5
857	Pittosporum undulatum						I 5
858	x Cuprocyparis leylandii						I 5
859	Lophostemon conferta						H6
860	Harpephyllum caffrum						H 6
861	Brachychiton populneum						H 6

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 23 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings N      S      E      W	RPZ (m)	WOR (1-10)	Plan grid reference
							Maintenance treatments at Jan 2006
862	<i>Fraxinus angustifolia</i>						G / H 6
863	<i>Fraxinus angustifolia</i>						G / H 6
864	<i>Fraxinus angustifolia</i>						G 5 / 6
865	<i>Fraxinus angustifolia</i>						G 5
866	<i>Neerium oleander</i>						G 5
867	<i>Fraxinus angustifolia</i>						G 5
868	<i>Fraxinus angustifolia</i>						G 5
869	<i>Lophostemon confertus</i>						G 5
870	<i>Eucalyptus macarthurii</i>						G 5
871	<i>Fraxinus angustifolia</i>						G 5
872	<i>Fraxinus angustifolia</i>						G 6
873	<i>Lophostemon confertus</i>						G 6
874	<i>Eucalyptus torquata</i>						G 6
875	<i>Platanus orientalis</i>						G 6
876	<i>Ligustrum lucidum</i>						G 6
877	<i>Acca sellowiana</i>						G 6
878	<i>Leptospermum petersonii</i>						G 6
879	<i>Fraxinus angustifolia</i>						F 6
880	<i>Acacia pravissima</i>						E 6
881	<i>Agonis flexuosa</i>						E 6
882	<i>Melaleuca styphelioides</i>						E 6
883	<i>Eucalyptus citriodora</i>						E 5 / 6
884	<i>Fraxinus angustifolia</i>						G 5
885	<i>Cotoneaster glaucophyllus</i>						G 5
886	<i>Pseudotanax lessonii</i>						G 5

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 24 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings N S E W	RPZ (m)	WOR (1-10)	Plan grid reference
							Maintenance treatments at Jan 2006
887	Agonis flexuosa						F 5
888	Schinus areira						F 4
889	Lophostemon confertus						G 5
890	Quercus canariensis						F 5
891	Quercus canariensis						F 5
892	Quercus canariensis						F 5
893	Acacia pycnantha						F 5
894	Quercus canariensis						F 5
895	Quercus canariensis				DW2 I	3	F 5
896	Prunus persica						F 5
897	Prunus persica						F 5
898	Agonis flexuosa						E 5
899	Callistemon "Kings Park Special"						E 5
900	Callistemon "Kings Park Special"						E 5
901	Quercus robur						F 5
902	Schinus areira						F 4
903	Quercus robur						E 4
904	Quercus robur						E 4
905	Allocasuarina verticillata						E 4
906	Casuarina glauca						E 4
907	Quercus canariensis						E 4
908	Acacia melanoxylon						E 3
910	Acacia melanoxylon						E 3
911	Acacia melanoxylon						E 3

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 25 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings N      S      E      W	RPZ (m)	WOR (1-10)	Plan grid reference
							Maintenance treatments at Jan 2006
912	Acacia melanoxylon						E 3
913	Cordyline australis						E 3
914	Cordyline australis						E 3
915	Pittosporum undulatum						E 3
916	Callistemon rugulosus						E 3
917	Acacia pycnantha						E 3
918	Callistemon pallidus						E 2
919	Callistemon rugulosus						E 2
920	Casuarina glauca						D 2
921	Casuarina glauca						E 2
922	Schinus areira						F 1
923	Lophostemon confertus						F 1
924	Eucalyptus leucoxylon						F 1
925	Robinia "Frisia"						F 1
926	Leptospermum petersoni						F 1
927	Melaleuca linariifolia						G 1
928	Melaleuca linariifolia						G 1
929	Melaleuca linariifolia						G 2
930	Casuarina glauca						G 2
931	Melaleuca linariifolia						G 2
932	Melaleuca linariifolia						G 2
933	Eucalyptus viminalis						G 2
934	Casuarina glauca						G 2
935	Casuarina glauca						G 2
936	Casuarina glauca						G 2

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 26 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings N      S      E      W	RPZ (m)	WOR (1-10)	Plan grid reference
							Maintenance treatments at Jan 2006
937	<i>Melaleuca armillaris</i>						F 2
938	<i>Eucalyptus viminalis</i>						F 2
939	<i>Hakea salicifolia</i>						F 2
940	<i>Melaleuca armillaris</i>						F 2
941	<i>Hakea salicifolia</i>						G 2
945	<i>Melaleuca armillaris</i>						F 2
946	<i>Allocasuarina torulosa</i>						F 2
947	<i>Melaleuca armillaris</i>						F 2
948	<i>Eucalyptus cinerea</i>						F 2
949	<i>Melaleuca armillaris</i>						F 2
950	<i>Hymenosporum flavum</i>						G 2
951	<i>Eucalyptus torquata</i>						G 3
952	<i>Eucalyptus torquata</i>						G 3
953	<i>Ulmus parvifolia</i>						F 3
954	<i>Ulmus parvifolia</i>						F 3
955	<i>Lophostemon confertus</i>						G 3
956	<i>Angophora costata</i>						G 3
957	<i>Lophostemon confertus</i>						G 3
958	<i>Eucalyptus maculata</i>						G 4
959	<i>Lophostemon confertus</i>						G 4
960	<i>Eucalyptus pulchella</i>						H 4
961	<i>Eucalyptus spathulata</i>						H 4
962	<i>Eucalyptus pulchella</i>						H 4
964	<i>Eucalyptus nicholii</i>						I 4
965	<i>Eucalyptus nicholii</i>						I 4

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 27 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings N      S      E      W	RPZ (m)	WOR (1-10)	Plan grid reference
							Maintenance treatments at Jan 2006
966	Melaleuca linariifolia						I 4
967	Eucalyptus nicholii						I 4
968	Eucalyptus nicholii						I 4
969	Eucalyptus nicholii						I 4
969A	Eucalyptus nicholii						J 4
970	Eucalyptus nicholii						J 4
971	Eucalyptus nicholii						J 4
972	Eucalyptus nicholii						J 4
972	Eucalyptus nicholii						J 4
973	Melaleuca styphelioides						J 4
974	Eucalyptus nicholii						J 4
975	Eucalyptus nicholii						J 4
976	Eucalyptus nicholii						J 4
977	Eucalyptus nicholii						J 4
978	Melaleuca styphelioides						J 4
989	Casuarina cunninghamiana						L 3
990	Eucalyptus globulus						L 3
991	Eucalyptus globulus						L 3
992	Eucalyptus melliodora						L 3
993	Eucalyptus melliodora						L 3
1000	Eucalyptus melliodora						N 3
1002	Eucalyptus camaldulensis						N 3
1003	Eucalyptus camaldulensis						N 3
1005	Eucalyptus camaldulensis						N 3
1007	Eucalyptus camaldulensis						M 2

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 28 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings N S E W	Maintenance treatments at Jan 2006	RPZ (m)	WOR (1-10)	Plan grid reference
1008	Eucalyptus melliodora							M 2
1009	Eucalyptus camaldulensis							M 2
1010	Ulmus glabra "Lutescens"							M 2
1011	Eucalyptus melliodora							M 2
1012	Ulmus glabra "Lutescens"							L2
1013	Eucalyptus camaldulensis							L 2
1014	Eucalyptus melliodora							K 2
1015	Eucalyptus camaldulensis							K 2
1016	Eucalyptus melliodora							K 2
1017	Eucalyptus camaldulensis							J 2
1018	Allocasuarina verticillata							K 4
1019	Eucalyptus melliodora							J 4
1020	Melaleuca styphelioides							J 4
1021	Allocasuarina verticillata							J 4
1022	Allocasuarina verticillata							J 3
1023	Eucalyptus caleyi							J 4
1024	Allocasuarina verticillata							J 3 / 4
1025	Eucalyptus melliodora							J 3
1026	Eucalyptus robusta							I / J 3
1027	Leptospermum laevigatum							I 3
1028	Leptospermum laevigatum							I 3
1029	Callistemon rugulosus							I 3
1030	Callistemon "Kings Park Special"							I 3
1031	Agonis flexuosa							I 3
1032	Fraxinus angustifolia							I 3

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 29 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings N S E W	RPZ (m)	WOR (1-10)	Plan grid reference
							Maintenance treatments at Jan 2006
1033	Agonis flexuosa						I 3
1034	Agonis flexuosa						I 3
1035	Agonis flexuosa						H 2
1036	Agonis flexuosa						H 2
1037	Ligustrum lucidum						I 2
1038	Callistemon "Harkness"						I 2
1039	Callistemon "Harkness"						I 2
1040	Fraxinus angustifolia						H 2
1041	Callistemon "Harkness"						H 2
1042	Lophostemon confertus						H 1
1043	Lophostemon confertus						H 1
1044	x Cuprocyparis leylandii						G 1
1045	Lophostemon confertus						G 1
1046	Lophostemon confertus						G 1
1047	Acacia baileyana						H 1
1048	Acacia pycnantha						I 2
1049	Eucalyptus caleyi						I 1
1050	Eucalyptus caleyi						I 1
1051	Eucalyptus caleyi						J 1
1052	Eucalyptus caleyi						J 1
1053	Quercus canariensis						D 3
1054	Quercus canariensis						E 3
1055	Quercus canariensis						D 4
1056	Quercus canariensis						E 4
1057	Quercus canariensis						D 4

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 30 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings	N	S	E	W	RPZ (m)	WOR (1-10)	Plan grid reference
											Maintenance treatments at Jan 2006
1058	Quercus canariensis										D 4
1059	Quercus canariensis										D 4
1060	Quercus canariensis										D 4
1061	Quercus canariensis										D 4
1062	Quercus canariensis										D 4
1063	Quercus canariensis										D 5
1064	Quercus canariensis										D 5
1065	Quercus canariensis										D 5
1066	Quercus canariensis										C 5
1067	Quercus canariensis										C 5
1068	Quercus canariensis										C 6
1069	Quercus canariensis										C 6
1070	Quercus canariensis										C 6
1071	Quercus canariensis										B 6
1072	Acacia podalyriifolia										B 6
1073	Quercus canariensis										B 6
1074	Quercus canariensis										B 6
1075	Quercus canariensis										B 7
1076	Pittosporum undulatum										B 7
1077	Melaleuca quinquenervia										D 6
1078	Callistemon salignus										D 6
1079	Hakea laurina										D 7
1080	Hakea laurina										D 7
1081	Ligustrum lucidum										C 7
1082	Callistemon rigidus										C 7 / 8

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 31 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings N      S      E      W	RPZ (m)	WOR (1-10)	Plan grid reference
							Maintenance treatments at Jan 2006
1083	<i>Melaleuca bracteata</i>						C 7
1084	<i>Lophostemon confertus</i>						D 7
1086	<i>Melaleuca armillaris</i>						D 9
1087	<i>Melaleuca armillaris</i>						D 9
1088	<i>Hakea laurina</i>						D 10
1089	<i>Grevillea robusta</i>						D 10
1090	<i>Pittosporum undulatum</i>						D 10
1091	<i>Pittosporum undulatum</i>						D 9
1092	<i>Arbutus unedo</i>						D 9
1093	<i>Acacia mearnsii</i>						C 8
1094	<i>Ligustrum lucidum</i>						C 8
1095	<i>Syzygium paniculatum</i>						C 8
1096	<i>Syzygium paniculatum</i>						C 8
1097	<i>Syzygium paniculatum</i>						C 8
1098	<i>Syzygium paniculatum</i>						C 8
1099	<i>Syzygium paniculatum</i>						C 8
1100	<i>Syzygium paniculatum</i>						C 8
1101	<i>Quercus canariensis</i>						B 7
1102	<i>Quercus canariensis</i>						B 7
1103	<i>Quercus canariensis</i>						A 7 / 8
1104	<i>Pittosporum undulatum</i>						A 8
1105	<i>Quercus canariensis</i>						A 8
1106	<i>Quercus canariensis</i>						A 8
1107	<i>Quercus hybrid</i>				DW		A 8
1108	<i>Quercus canariensis</i>						A 8

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 32 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings N S E W	Maintenance treatments at Jan 2006	RPZ (m)	WOR (1-10)	Plan grid reference
1109	Quercus canariensis							A 8
1110	Arbutus unedo							A8
1111	Arbutus unedo							A8
1112	Cupressus torulosa							A 8
1113	Quercus canariensis							A 8
1114	Quercus canariensis		Dead tree					
1115	Pittosporum undulatum							A 8
1116	Quercus canariensis				DW			A 8
1117	Quercus canariensis							B 8
1118	Quercus canariensis				DW I			A 9
1119	Quercus canariensis				DW I	3		A 9
1120	Cedrus deodara				DW I			A 9
1122	Acacia decurrens							A 9
1123	Lophostemon confertus				I			B 9
1124	Quercus canariensis							B 9
1125	Eucalyptus maculata							A 9
1126	Cedrus deodara							A 9
1127	Arbutus unedo							B 9
1128	Quercus canariensis				DW I			B 9
1129	Quercus canariensis				DW2 I			B 9
1130	Arbutus unedo							B 9
1131	Quercus canariensis							B 9
1132	Ficus macrophylla							B 10
1133	Pittosporum undulatum							B 10
1134	Quercus canariensis				DW2 I			B 9

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 33 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings N S E W	RPZ (m)	WOR (1-10)	Plan grid reference
							Maintenance treatments at Jan 2006
1135	Cedrus atlantica						B 9
1136	Quercus canariensis						B 9
1137	Quercus canariensis						C 9
1138	Quercus canariensis						C 9
1140	Quercus canariensis						C 9
1141	Quercus robur				I		C 9
1142	Quercus canariensis						C 9
1143	Quercus canariensis				I		C 9
1144	Eucalyptus ficifolia				I		B 9
1145	Pittosporum undulatum						C 9
1146	Pittosporum undulatum						C 9
1147	Quercus canariensis				DW2 I		C 10
1148	Quercus canariensis				DW I		C 10
1149	Quercus canariensis				DW I		C 10
1150	Quercus canariensis				DW I		C 10
1151	Quercus hybrid						C 10
1152	Cupressus sempervirens "Stricta"						C10
1153	Cedrus atlantica						C 10
1154	Ficus macrophylla						C 10
1155	Ulmus procera						C 10
1156	Ficus macrophylla						C 10
1157	Ulmus procera						C 10
1158	Ficus macrophylla						C 10
1159	Ficus macrophylla				I		C 10
1160	Ulmus procera						D 10

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 34 of 36

Tree No.	Species	DBH (cm)	Condition G/F/P	Minimum distance from trunk centre in each of 4 cardinal directions for construction of dwellings				RPZ (m)	WOR (1-10)	Plan grid reference
				N	S	E	W			
1161	<i>Ulmus procera</i>									D 10
1162	<i>Ulmus procera</i>									D 10
1163	<i>Ficus macrophylla</i>									D 10
1164	<i>Quercus canariensis</i>						I			D 10 / 11
1165	<i>Quercus canariensis</i>									D 10 / 11
1166	<i>Ulmus procera</i>						DW			D 10
1167	<i>Ulmus procera</i>									D 10
1168	<i>Ficus macrophylla</i>									D 10
1169	<i>Ulmus procera</i>	58	P	4	3	5	6		4.5	E 10
1170	<i>Ficus macrophylla</i>						DW			D 10
1171	<i>Ulmus procera</i>						DW			E 10
1172	<i>Quercus canariensis</i>									E 11
1173	<i>Quercus canariensis</i>									E 11
1174	<i>Ulmus procera</i>									E 10
1175	<i>Quercus canariensis</i>						DW I			E 11
1176	<i>Quercus canariensis</i>						DW2 I		2	E 11
1177	<i>Ulmus procera</i>									E 10
1178	<i>Ficus macrophylla</i>	37	F/P	5	3	4	5	I	3.5	E 10
1179	<i>Cupressus torulosa</i>	43	F/P	3	4	3	4		3	E 10

KEW COTTAGES- INFORMATION TO ACCOMPANY MDG TREE PROTECTION PLAN 0418 LSK11

MDG Landscape Architects Level 2 / 45 Victoria Avenue Albert Park VIC 3206 T 9696 4957 F 9696 3594  
 Galbraith and Associates Tree Consultants and Contractors 40 Glyndon Road Camberwell VIC 3124 T 9888 5241 F 9888 5063  
 J:\Kew Cottages\0418 Kew Cottages GENERAL\misc\Rob G tree reports\KRS tree species list 0418 RP01 Issue F.doc  
 Issued A 21.12.05, B 19.01.06, C 25.01.06, D 15.02.06, E 03.03.06, F 13.04.06  
 Page 35 of 36

